


Instructions for use of the Scotchflex 3430-7000 Hand Tool (Scribe)

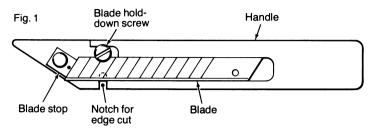

General:


The Scotchflex 3430-7000 hand tool is designed to:

- Score the PVC jacket on Scotchflex jacketed cables to facilitate removal prior to assembling a connector to the inner cable.
- Score the PVC cover on Scotchflex ground plane cables to facilitate removal prior to assembling a connector to the cable.


The 3507 guide is provided as an aid in assuring a straight, perpendicular cut as well as a length reference for ease in using the 3430-7000 hand tool.

When properly used, the hand tool will scribe the PVC to a depth slightly less than the jacket thickness. The jacket can then be easily removed by tearing along the scribe line. The scribe, being less than the jacket thickness, assures the shield or cable below will not be nicked or cut.


Operation for Jacketed Cable

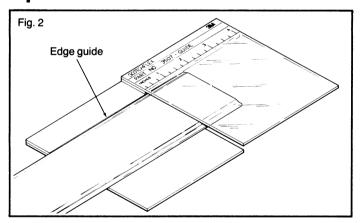


- 1. The cable should be first cut to length, using the Scotchflex 3437-1A Cable Shear.
- Place the cable in the 3507 guide, extending under the clear portion, up to the inch mark of the length desired for exposed cable length. The cable should be butted against the edge guide provided (see Figure 2) to insure a perpendicular cut.
- 3. Draw the hand tool across the cable from edge to edge, making sure to keep the hand tool in contact with the clear plastic guide. To insure the correct scribe depth, keep the flat surface of the hand tool against the cable (Figure 3).
- 4. Remove cable from the guide, turn over and re-insert to the same length mark as in (2). Scribe across cable as in (3).

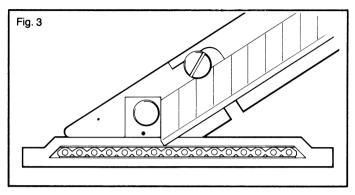

5. Remove cable and make a scribe extending from cross-cable scribe to the end of the cable (Figure 4).

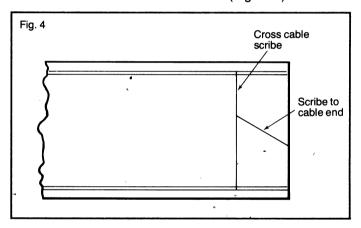


- Using the notch in the hand tool, cut the edge of the cable jacket to line up with the score marks (Figure 5).
- 7. Grasp the jacket material on each side of the score mark extending to the end of the cable and tear up to the cross-cable score line. The jacket can now be removed by tearing the end away from the remaining jacket.

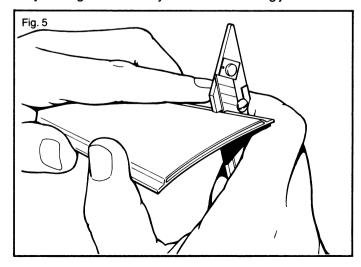

Operation for Ground Plane Cable

- 1. The cable should be first cut to length using the Scotchflex 3437-1A Cable Shear.
- 2. After the cable has been notched (see instructions for the 3557) the cable clamp on the 3557 can be used as a guide or the 3507 can be used as a guide.
- 3. Draw the hand tool across the bottom of the cable to scribe the PVC cover as in (3) above.
- Make a second scribe as in 5 above.
- 5. Using a tweezers or similar tool, lift the PVC cover from the ground plane and peel it away.



CABLE WIDTH	JACKET THICKNESS	HAND TOOL SETTING
1.5" or less	.032'' nom.	DOT
1.5" to 2.5"	.047'' nom.	DOT
2.5" to 3.5"	.062'' nom.	DOT
Ground Plane Cable	.007'' nom.	DOT

Hand Tool Adjustment

The hand tool provides four blade depth settings to correspond with the three thicknesses of cable jacketing as well as the cover over the ground plane on ground plane cable. /

Blade adjustment for jacketed cable

- 1. The jacket thickness increases as the cable width increases as required by U.L. Correspondingly, the blade extension must change for each jacket thickness change. Refer to the following table for settings of the blade stop.
- 2. Loosen blade hold-down screw. Slide blade back from blade stop and rotate blade stop to desired setting (Table 1). Slide blade forward until it stops against blade stop and tighten blade hold-down screw.
- 3. Check the setting by making a test cut. Tear the jacket apart at the test cut and visually inspect the inner cable or ground plane for nicks.

Blade adjustment for ground plane cable

- 1. Follow steps 1 and 2 from Jacketed Cable Procedure.
- 2. The extension of the blade must be closely controlled to .008" for ground plane cable. This can be accomplished by grinding the blade to length. Lay the enclosed .008" thick metal strip on the enclosed 600 grit abrasive paper.
- 3. Place the hand tool body on the metal strip so that the blade hangs over the edge. Drawing the knife along the edge of the strip will cause the blade to be ground to length.

Blade replacement

The hand tool is supplied with a break-away style blade. As a tip becomes dull, the end can be broken off, exposing a new, sharp point.

- 1. Loosen the blade hold-down screw.
- 2. Remove the blade from the hand tool.
- 3. Place the blade on a flat surface with the score marks facing down.
- 4. Bend the end section upward while holding the remaining section down to the flat surface. The blade should break cleanly along the scoremark.
- 5. Replace the blade into the hand tool and adjust per blade adjustment section.

Important Notice to Purchaser

All statements, technical information and recommendations contained herein are based on tests we believe to be reliable, but the accuracy or completeness thereof is not guaranteed, and the following is made in lieu of all warranties, expressed or implied:

Seller's and manufacturer's only obligation shall be to replace such quantity of the product proved to be defective. Neither seller nor manufacturer shall be liable for any injury, loss or damage, direct or consequential, arising out of the use of or the inability to use the products. Before using, user shall determine the suitability of the product for his intended use, and user assumes all risk and liability whatsoever in connection therewith.

No statement or recommendation not contained herein shall have any force or effect unless in an agreement signed by officers of seller and manufacturer.





OOO «ЛайфЭлектроникс" "LifeElectronics" LLC

ИНН 7805602321 КПП 780501001 P/C 40702810122510004610 ФАКБ "АБСОЛЮТ БАНК" (ЗАО) в г.Санкт-Петербурге К/С 3010181090000000703 БИК 044030703

Компания «Life Electronics» занимается поставками электронных компонентов импортного и отечественного производства от производителей и со складов крупных дистрибьюторов Европы, Америки и Азии.

С конца 2013 года компания активно расширяет линейку поставок компонентов по направлению коаксиальный кабель, кварцевые генераторы и конденсаторы (керамические, пленочные, электролитические), за счёт заключения дистрибьюторских договоров

Мы предлагаем:

- Конкурентоспособные цены и скидки постоянным клиентам.
- Специальные условия для постоянных клиентов.
- Подбор аналогов.
- Поставку компонентов в любых объемах, удовлетворяющих вашим потребностям.
- Приемлемые сроки поставки, возможна ускоренная поставка.
- Доставку товара в любую точку России и стран СНГ.
- Комплексную поставку.
- Работу по проектам и поставку образцов.
- Формирование склада под заказчика.
- Сертификаты соответствия на поставляемую продукцию (по желанию клиента).
- Тестирование поставляемой продукции.
- Поставку компонентов, требующих военную и космическую приемку.
- Входной контроль качества.
- Наличие сертификата ISO.

В составе нашей компании организован Конструкторский отдел, призванный помогать разработчикам, и инженерам.

Конструкторский отдел помогает осуществить:

- Регистрацию проекта у производителя компонентов.
- Техническую поддержку проекта.
- Защиту от снятия компонента с производства.
- Оценку стоимости проекта по компонентам.
- Изготовление тестовой платы монтаж и пусконаладочные работы.



Тел: +7 (812) 336 43 04 (многоканальный) Email: org@lifeelectronics.ru